

LASER[®]

SLR Registration Returns Form

Complete and return this form. No stamp required.

Part Number: **5370**

Serial Number:

Customer Name:

Business Name:

Your Address:

Your Postcode:

Your Email:

For new product updates

LASER[®]

FAP | DPF Reset Tool

Peugeot | Citroën

Instructions



- Compatible with the latest CAN equipped vehicles
- Unit powered by the vehicle - no batteries required
- Simple to use with clear instructions - "plug and play functionality"
- Enables fuel additive functions for replacement of DPF filters
- Enables the resetting of additive reset lights and forcing of the regenerative process (forced burn off)



For updates go to Laser Tools website

Features | Operation


- Compatible with latest CAN vehicles
- Enables Fuel Additive functions for replacing Filters, resetting Additive Reset Lights and performing the Regenerate process.

The new Peugeot / Citroën Particulate tool has been designed to extinguish the Particulate Filter Light after the filter has been replaced, reset the EOLYS additive after it has been topped up, burn off any particles that have clogged the filters (Regenerate).


Filter Replace	This is a light on the dashboard that is illuminated when the filter is clogged and needs changing or potentially regenerating.
Additive Reset	This is a light on the dashboard that is illuminated when the fuel additive is empty or low and needs refilling.
Regenerate Filter	This will rev the engine to around 4000 RPM's which in turn will increase the temperature of the exhaust gases; this causes the soot that has built up on the filter to be burnt off.

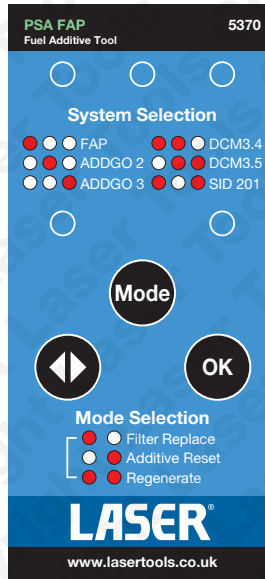

System Selection for selecting different Fuel additive systems.

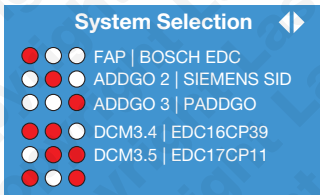

Full Description for system selection.



MODE Selection for selecting the type of function you want to perform.

PSA FAP User Instructions



Function Select button



Mode button



OK button

The Tool Connection Limited
Kineton Road
Southam
Warwickshire
CV47 0BR

RESPONSE SERVICE
License No MID24946

Application List

Peugeot Service Reset

Vehicle	Type	Engine Codes	Year
207	PADDGO	ALL CODES	09-11
307	DELPHI DCM 3.4	RHF	07-10
307	DELPHI DCM 3.4	RHL	07-10
307	DELPHI DCM 3.4	RHR	07-10
307	ADDGO 2		00-04
307	ADDGO 3		05-07
308	DELPHI DCM 3.4	RHF	07-11
308	DELPHI DCM 3.5	RHH	07-11
308	DELPHI DCM 3.4	RHL	07-11
308	DELPHI DCM 3.4	RHR	07-11
308	PADDGO	ALL CODES	08-11
406	MARELLI FAP	4HZ (DW12ATED)	00-04
407	DELPHI DCM 3.4	RHF	07-11
407	DELPHI DCM 3.4	RHL	07-11
407	DELPHI DCM 3.4	RHR	07-11
407	EDC16CP39 FAP	4HP	07-11
407	EDC16CP39 FAP	4HR	07-11
407	EDC16CP39 FAP	4HS	07-11
407	EDC16CP39 FAP	4HT	07-11
407	SID201 FAP	UHZ	07-11
407	BOSCH EDC17CP11		09-11
407	ADDGO 3		06-08
607	MARELLI FAP	4HX (DW12ATED)	99-04
806	ADDGO 2	RHY	00-04
807	MARELLI FAP	4HW (DW12ATED)	02-04
807	EDC16CP39 FAP	4HP	07-11
807	EDC16CP39 FAP	4HR	07-11
807	EDC16CP39 FAP	4HS	07-11
807	EDC16CP39 FAP	4HT	07-11
807	ADDGO 3		05-07
1007	PADDGO	ALL CODES	04-09
3008	DELPHI DCM 3.5	RHH / RHE	07-11
3008	PADDGO	ALL CODES	09-11
5008	DELPHI DCM 3.5	4HN	09-11
4007	EDC16CP39 FAP	4HN	07-11
406 COUPE	MARELLI FAP	4HZ (DW12ATED)	00-04
PARTNER	ADDGO 2	RHY	00-04

Vehicle Set-Up

1. Ensure the vehicle is parked outside on a non-flammable surface away from any combustibles, engine warm with at least ¼ tank of fuel and that there are no fault codes stored (the exhaust system will be at temperatures above 500°C).
2. Ensure vehicle ignition is turned off.
3. Using the application list and socket location diagrams, connect the PSA FAP tool to the identified diagnostic socket.
4. Turn on the vehicle ignition.

Notes: As part of the process a Clear codes message will be sent to the vehicle (any faults that are permanent on the vehicle will remain until the fault is fixed).

Ensure no one goes near the rear / exhaust area of the vehicle.

Regeneration takes around 15 mins in total. 2 mins running at idle, 8 mins at 4000 rpm and 5 mins at idle again.

During the regeneration process very hot exhaust gasses will be expelled from the rear of the car and a large amount of soot and smoke may well also be expelled.

For this reason the process must be carried out in a well ventilated area.

Due to the nature of this process (engine running at high revs for 8 minutes) The Tool connection cannot accept any responsibility for engine failure how so ever caused nor for any injuries to personnel.

Filter Replace



1. Press the function button to select the appropriate system (There is a full list of systems on the rear of the PSA FAP Tool).



2. Press the 'MODE' button to select correct type (Filter Replace).



3. Press 'OK' to perform the function.



4. Once the system has completed the mode LED will flash to indicate a successful reset.



5. If the function is unsuccessful, the 3 Function LED's Selection will flash.

Additive Reset



1. Press the function button to select the appropriate system (There is a full list of systems on the rear of the PSA FAP Tool).
2. Press the **'MODE'** button to select correct type (Additive Reset).
3. Press the function button to select the appropriate system (There is a full list of systems on the rear of the PSA FAP Tool).
4. Press **'OK'** to perform the function.
5. Once the system has completed the mode LED will flash to indicate a successful reset.
6. If the function is unsuccessful, the 3 Function LED's Selection will flash.
7. Disconnect tester, open filler cap for more than 5 seconds, then close again.

Regenerate Filter



1. Start the vehicle engine and allow the vehicle to warm-up.
2. Press the function button to select the appropriate system (There is a full list of systems on the rear of the PSA FAP Tool).
3. Press the **'MODE'** button to select correct type (Regenerate Filter).
4. Press **'OK'** to perform the function.
5. Once the system has completed the mode LED will flash to indicate a successful reset.
6. If the function is unsuccessful, the 3 Function LED's Selection will flash.
7. Switch the ignition off, unplug tool and turn ignition on.

Application List

Citroën Service Reset

Vehicle	Type	Engine Codes	Year
C3 Picasso	PADDGO	ALL CODES	08-11
C4	PADDGO	ALL CODES	06-11
C4 Picasso	PADDGO	ALL CODES	06-11
C5	DELPHI DCM 3.4	RHR	07-10
C5	ADDGO 2	RHS	00-04
C5	ADDGO 2	RHY	00-04
C5	ADDGO 2	RHZ	00-04
C5	MARELLI FAP	4HX (DW12TED4)	00-04
C5	MARELLI FAP	4HX (DW12TED4)	00-04
C5	MARELLI FAP	RHR	00-04
C5	EDC16CP39 FAP	4HP	07-11
C5	EDC16CP39 FAP	4HR	07-11
C5	EDC16CP39 FAP	4HS	07-11
C5	EDC16CP39 FAP	4HT	07-11
C5	SIEMENS SID 201 FAP	UHZ	07-11
C5	BOSCH EDC17CP11		09-11
C5	ADDGO 3		04-08
C6	EDC16CP39 FAP	4HP	07-10
C6	EDC16CP39 FAP	4HR	07-11
C6	EDC16CP39 FAP	4HS	07-11
C6	EDC16CP39 FAP	4HT	07-11
C6	SIEMENS SID 201 FAP	UHZ	07-11
C6	BOSCH EDC17CP11		09-10
C8	MARELLI FAP	4HX (DW12TED4)	02-07
C8	ADDGO 3		06-08
BERLINGO	ADDGO 2	RHY	00-04
C-CROSSER	EDC16CP39 FAP	4HN	07-11
XSARA PICASSO	ADDGO 2	RHY	00-04

Guarantee

If this product fails through faulty materials or workmanship, contact our service department direct on: +44 (0) 1926 818186. Normal wear and tear are excluded as are consumable items and abuse.